WHEN TO CLEAR

OVER YOUR BASECOAT

The recoat window, one slide per rule




@thespraysource

BASE DRY TO THE TOUCH?

THEN IT IS READY FOR CLEAR

15 min in a booth, else 30 to 60 min at 70F or warmer

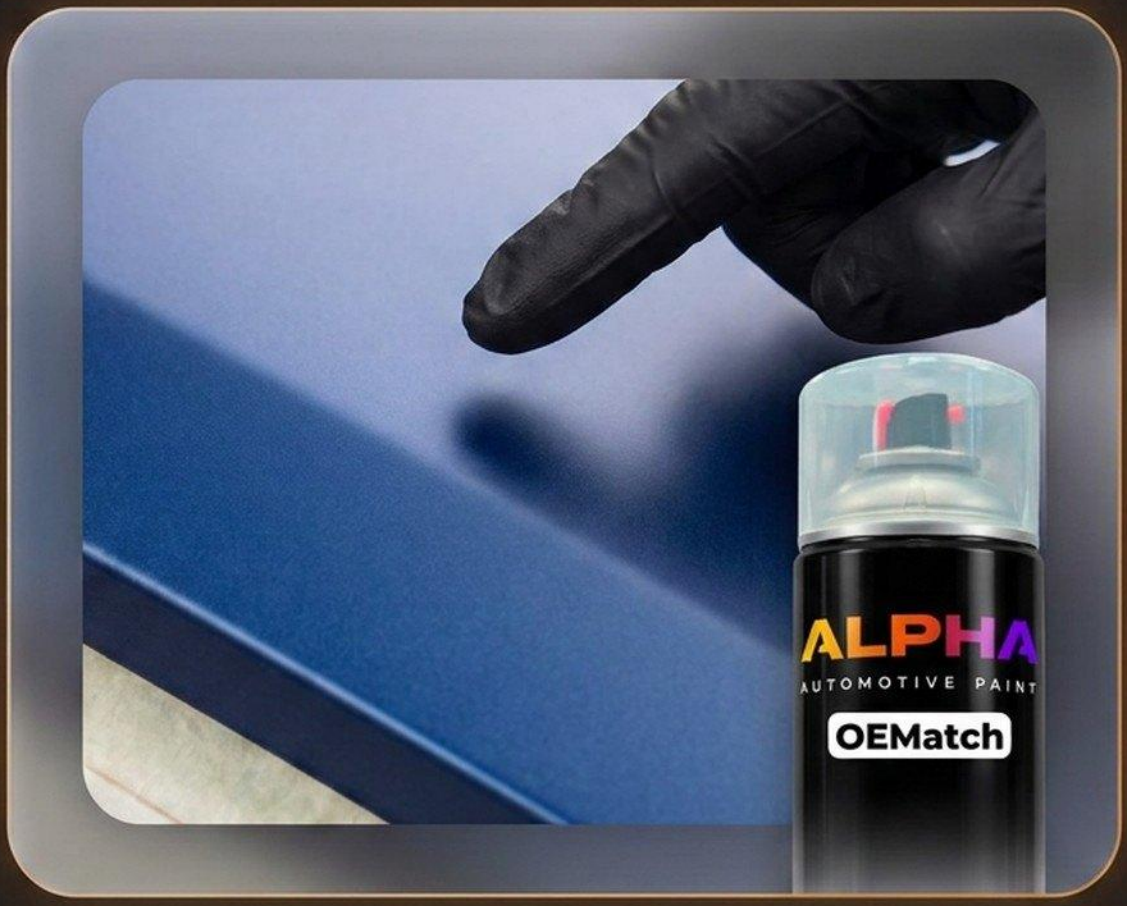


@thespraysource

CLEAR WHEN DRY TO THE TOUCH

15 MIN IN A BOOTH

Otherwise 30 to 60 minutes at 70F or warmer

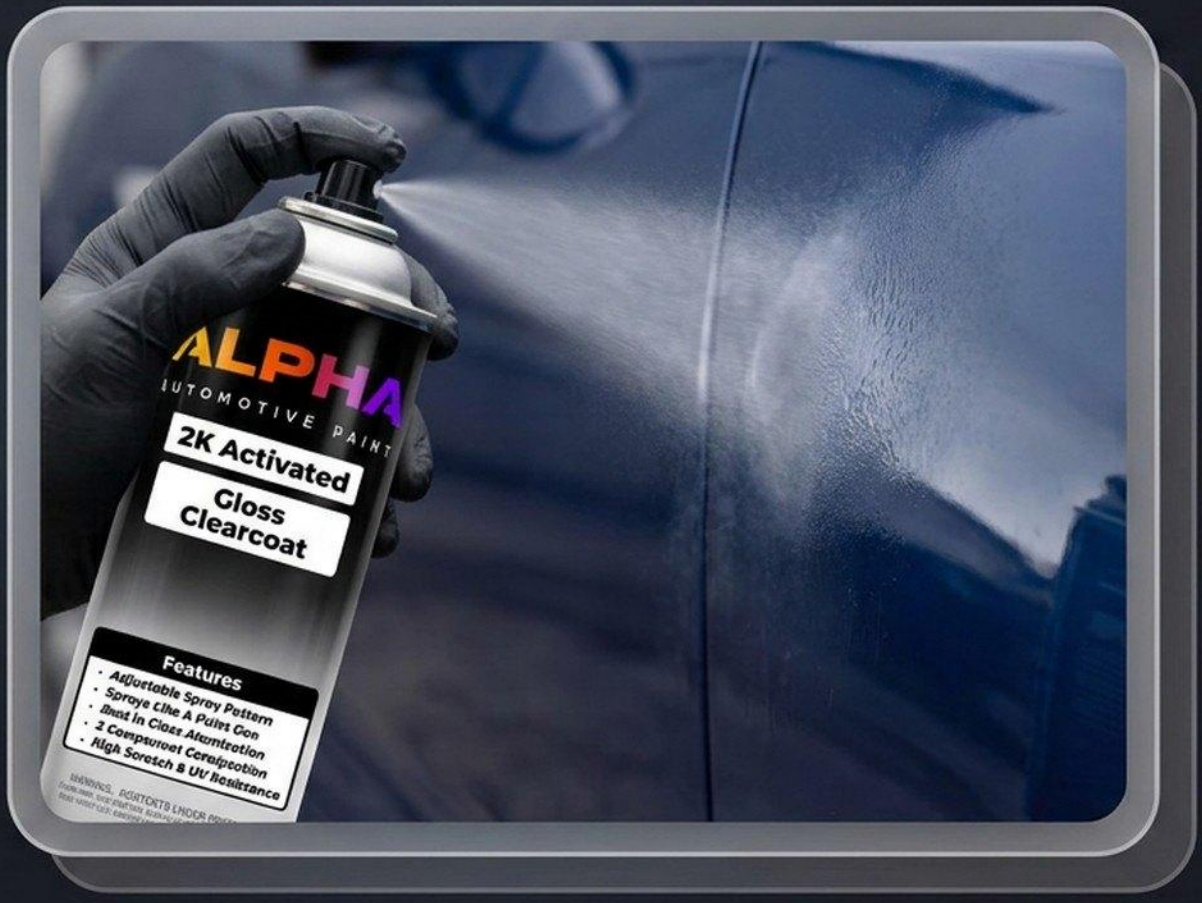

@thespraysource

PAST 8 HOURS?

SCUFF + ONE MORE BASECOAT

Then clear once it is dry to the touch



@thespraysource

ACTIVATE THE 2K CAN

ONLY WHEN READY TO SPRAY

Pull the ring and bar on the bottom, turn 360°. About 24 hour pot life



@thespraysource

2 TO 3 WET COATS

RECOAT AT FINGERPRINT

About 10 minutes between coats. Check the masking



@thespraysource

UNMASK AT 30 MINUTES

HANDLE AT 8 HOURS

Polish or recoat after 12 hours



@thespraysource

SPRAY GUN BASECOAT?

8+ HOURS: SAND 600 TO 800

Then 2 full coats of clear, 8 to 10 minutes flash



@thespraysource

READ THE FULL GUIDE

THESPRAYSOURCE.COM

/pages/spray-cans



@thespraysource